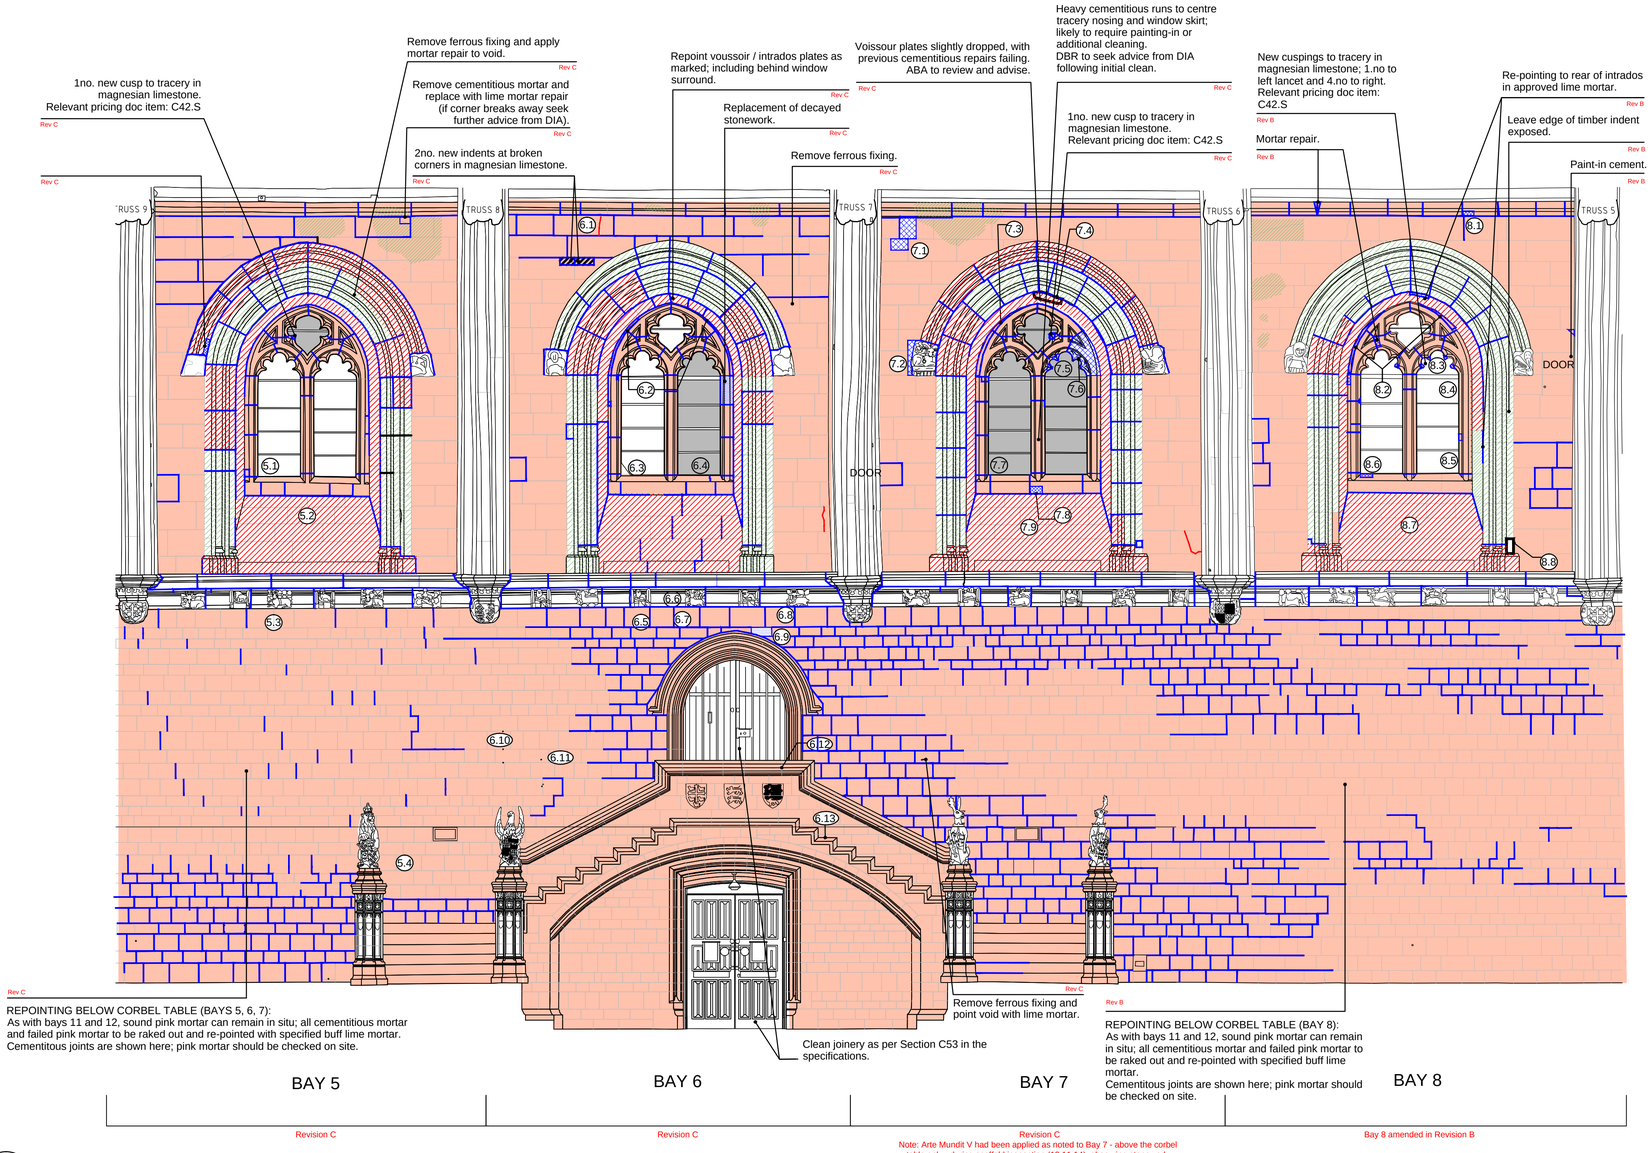

1
2010
West Elevation Bays 5-8
1:50

REPAIR KEY

- Remove existing loose or disfiguring mortar and re-point as C42/506 using lime mortar to match approved sample as Z21.
- Remove loose surface with a stiff/ soft bristle brush as C42/120. Brush back to sound surface and seek further instructions.
- Clean stone surfaces using 1No. applications of Arte Mundit V, as C40/500-510 for review. Further cleaning may be required and will be instructed by the PM if necessary.
- Remove loose surface with a stiff/ soft bristle brush as C42/120. Brush back to sound surface and seek further instructions. Following completion, clean stone surfaces using 1No. applications of Arte Mundit V, as C40/500-510 for review. Further cleaning may be required and will be instructed by the PM if necessary.
- Clean stone surfaces using 2No. applications of Arte Mundit V, as C40/500-510 for review. Further cleaning may be required and will be instructed by the PM if necessary.
- Remove loose surface with a stiff/ soft bristle brush as C42/120. Brush back to sound surface and seek further instructions. Following completion, clean stone surfaces using 2No. applications of Arte Mundit V, as C40/500-510 for review. Further cleaning may be required and will be instructed by the PM if necessary.
- Clean stone surfaces using 2No. applications of Arte Mundit V and one application of Laponite poultice for review. Further cleaning may be required and will be instructed by the PM if necessary.
- Cut out decayed or damaged area of existing stone and repair with stone indent.
- Cut out decayed existing stone in its entirety and replace with new stone.
- Remove existing glazing and reinstate on completion of masonry repairs.
- Cracks in existing stonework to be pinned as noted on drawing.

GENERAL REPAIR NOTES

1. Clean all areas of ashlar to the walls and window reveals and areas of cornice as per Section C40 specifications. Only sections of Magnesian limestone tracery and window surround are to be cleaned--sections of Reigate stonework are to be only brushed down.
2. All repairs and cleaning works to the frieze, heraldic beasts to the stairs and label stops are to be undertaken as per "Summary Report and Specification for Carved Frieze and Other Carved Elements."
3. All glazing not scheduled for removal should be protected as per section L50 of the specifications prior to commencement of cleaning and repair works.
4. Remove existing failing finishes from all ferementa to window glazing and refinish as per sections L50 and M60 of the specifications.
5. Include for removing all redundant electrical services, remove existing steel plates/ plywood battles etc., and clear away. Repair holes to stone with lime mortar, all as relevant sections of the specifications.

ALL NUMBERED REFERENCES REFER TO REPAIR SCHEDULE ON DRAWING 6001

No.	NOTES (STATUS: F. FEASIBILITY S. SKETCH DESIGN P. PLANNING B. BUILDING CONTROL D. DESIGN DEV / PRELIM M. MEASUREMENT T. TENDER C. CONTRACT R. RECORD W. WORKING DRAWING)
1	For construction use only if status 'C' and checked against current revision
2	All dimensions to be checked on site by contractor
3	Do not scale from this drawing
4	Unless otherwise indicated all dimensions are in millimetres

Rev	Date	Dwn	Auth	REVISIONS
C	12/11/14	ERL	ARR	REVISIONS TO **BAYS 5, 6, 7 ONLY** FOLLOWING SITE VISIT (SCAFFOLD ACCESS) - MOSTLY REPOINTING, PLUS NOTED REVISIONS 'C' ON DRAWING.
B	29/10/14	ERL	ARR	REVISIONS TO **BAY 8 ONLY** FOLLOWING SITE VISIT (SCAFFOLD ACCESS) - MOSTLY REPOINTING, PLUS NOTED REVISIONS 'B' ON DRAWING.
A	24/01/14	ARR	PXD	CONSTRUCTION ISSUE
-	20/13/13	ARR	PXD	TENDER ISSUE

CHARTERED ARCHITECTS
PLANNING CONSULTANTS

Job WESTMINSTER HALL CONSERVATION PROJECT
Title WEST ELEVATION BAYS 5-8: REPAIRS

Job PW.WH3	Status C
No 2010	Rev C
Scale (A1)	1:50

Last saved on 13/11/2014 filename:w:\jobs\pw.wh.3\sheets\2 general arrangement\2010_west bays 5-8.dwg by ERL