GENERAL REPAIR NOTES


1. Generally clean stone surface to window hood, window reveal, tracery,label stops, and ***ashlar to the north wall below the carved label stops*** as C40/482 before undertaking the stonework repairs shown on this drawing. Scope of cleaning works is defined by the dashed line and is to extend the full length of the window.
2. Remove glazing panels as shown on drawings 2003 and 2004 before commencing stonework repairs as shown on this drawing.
3. Remove loose surface material from ashlar to the west face of the east tower.
4. Remove existing lead flashing to the arch's extrados (leave the flashing to the carved harts in situ) and to the cill. Install new flashing to the arch's extrados, to the heads of the carved harts and to the cill as per details on DIA Drawing 2006.

ANNOTATION KEY

- 1.00 — Magnesian Limestone full stone replacement
- 2.00 — Magnesian Limestone stone indent
- 3.00 — Bath Stone full stone replacement *(N.B. stone indents to transoms)*
- 4.00 — Bath Stone indent
- 5.00 — Plastic Repair

REPAIR KEY

- Remove existing loose or disfiguring mortar and re-point as C42/506 using lime mortar to match approved sample as Z21.
- Remove loose surface with a stiff/ soft bristle brush as C42/120. Brush back to sound surface and seek further instructions.
- ~~Cut out decayed existing stone and replace with new stone indent repair.~~
- *Hatch not in use*
- ~~Cut out decayed existing stone in its entirety and replace with new stone~~.
- Cracks in existing stonework to be pinned as instructed by the PM.

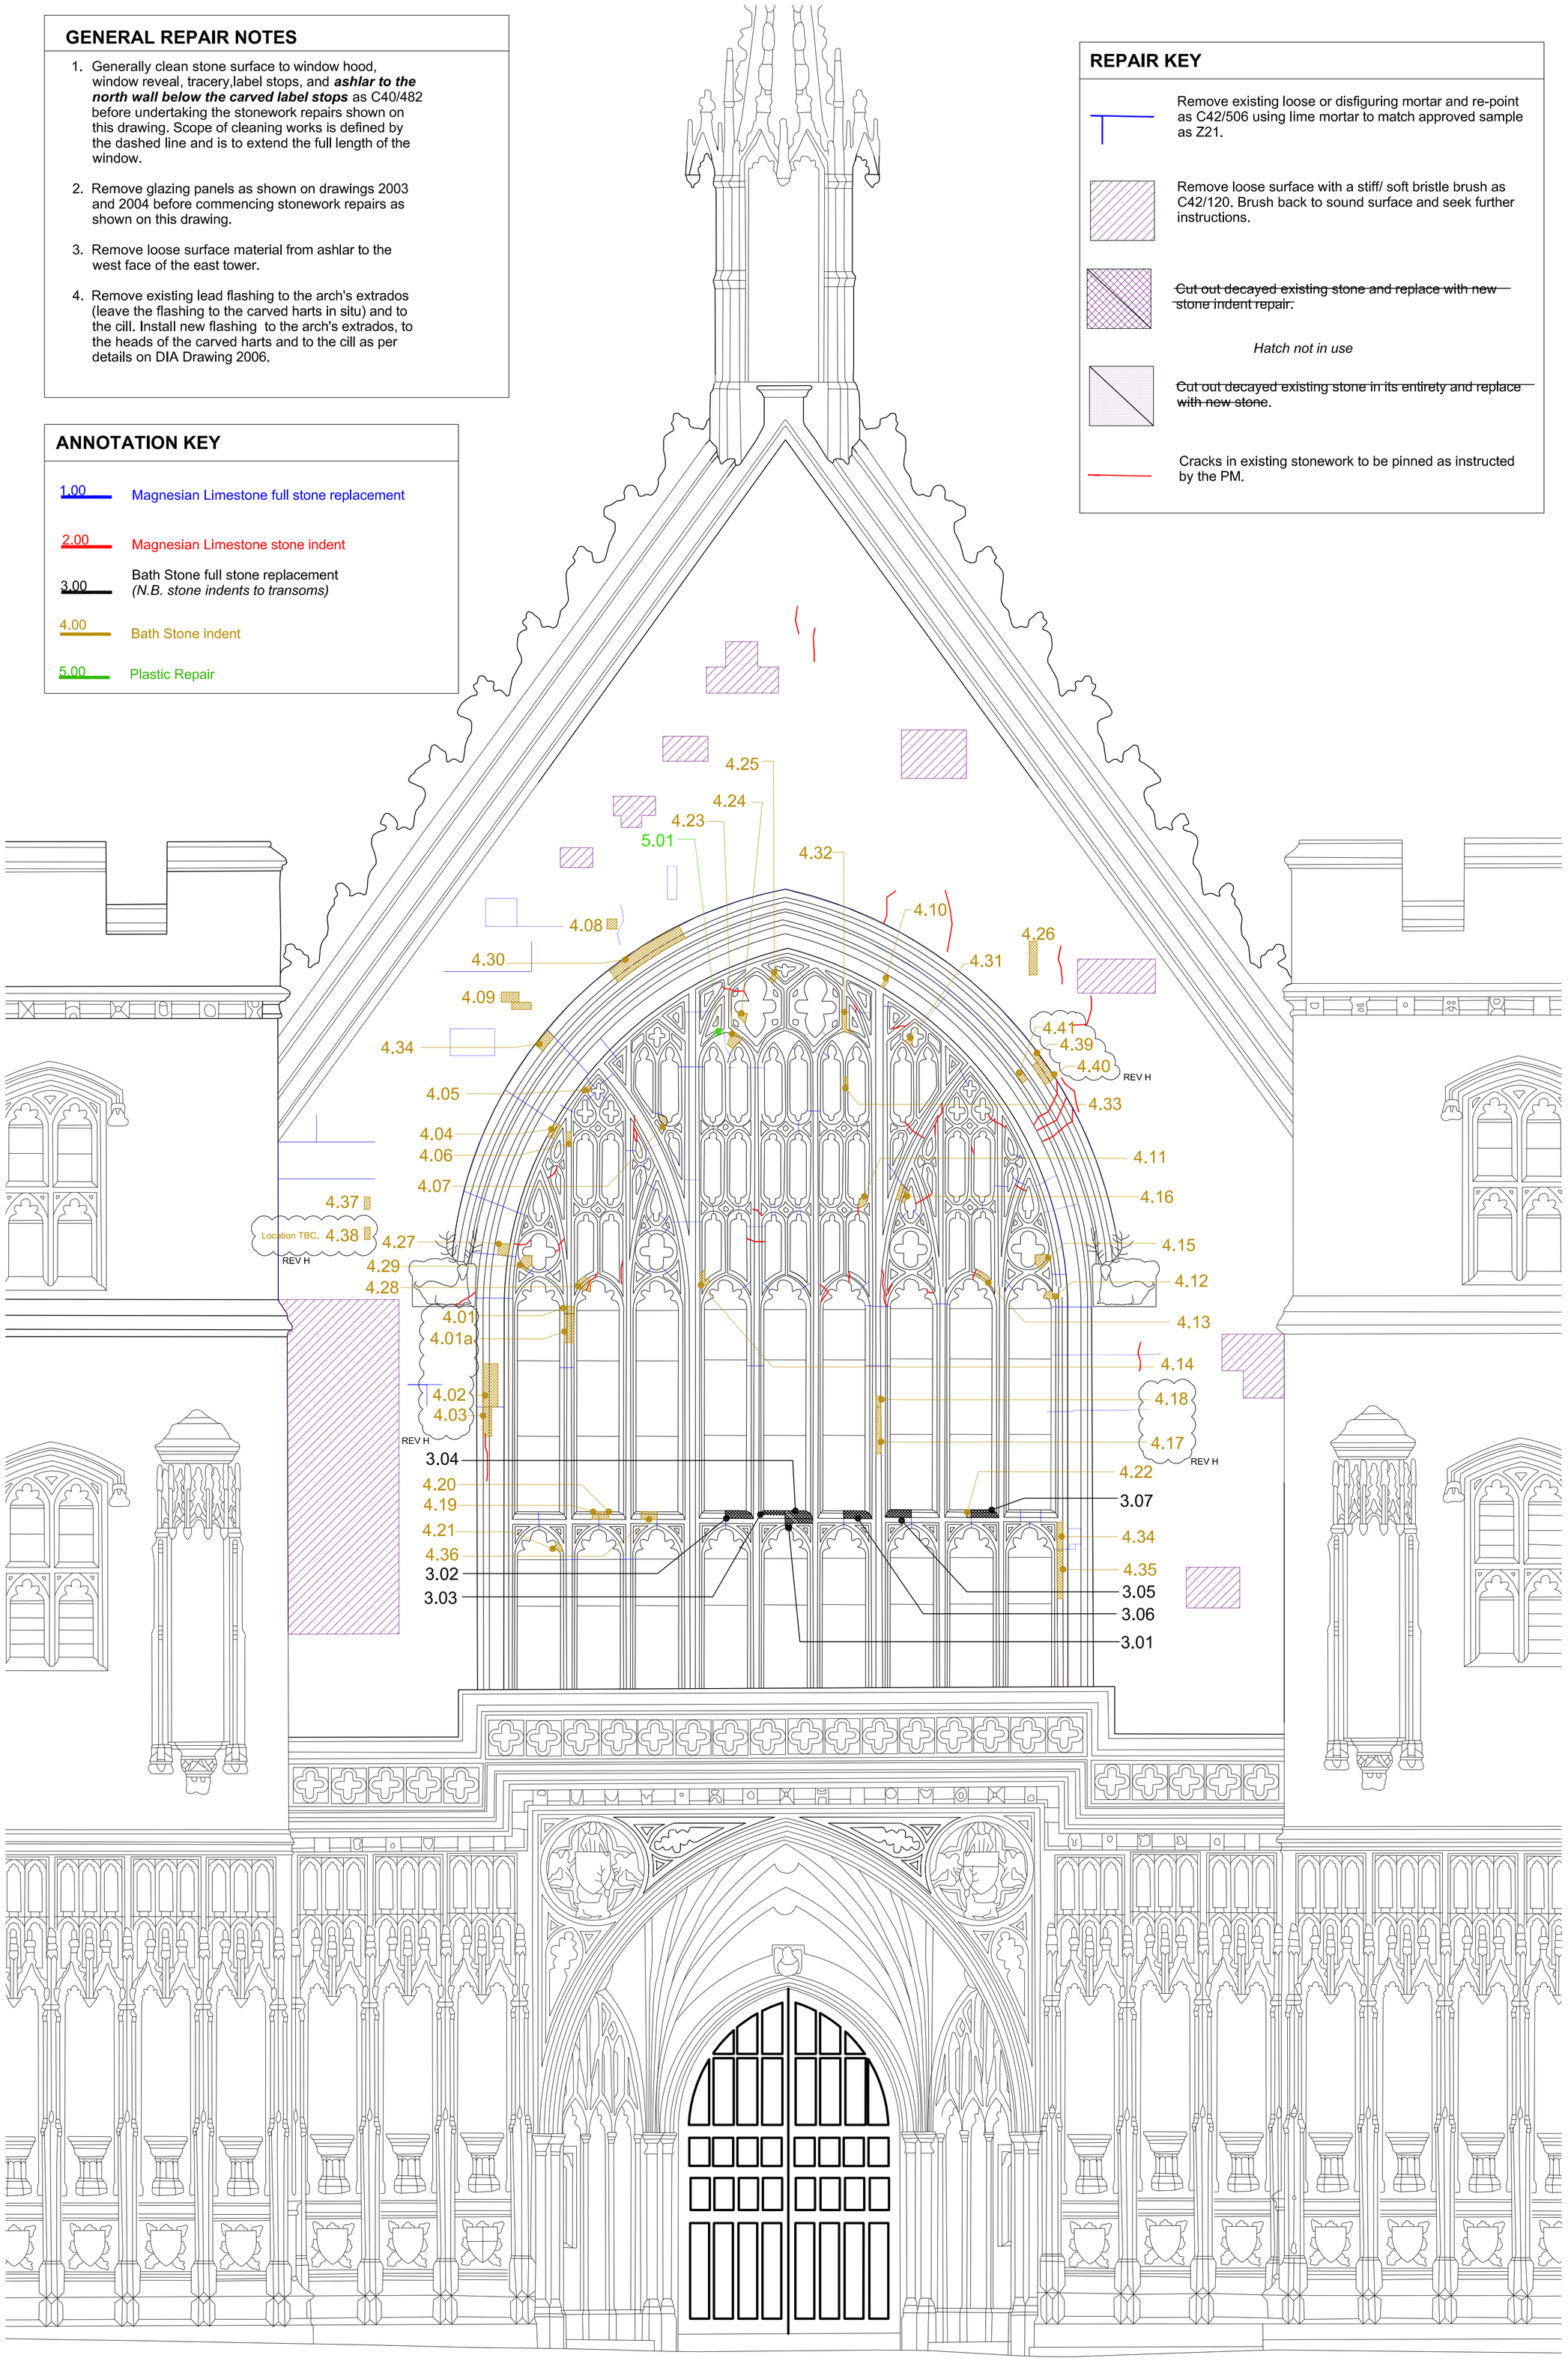

1 / 2001 North Window Exterior 1:50

NOTES (STATUS: F. FEASIBLITY S. SKETCH DESIGN P. PLANNING B. BUILDING CONTROL D. DESIGN DEV / PRELIM M. MEASUREMENT T. TENDER C. CONSTRUCTION R. RECORD)

1. For construction use only if status 'C' and checked against current revision
2. All dimensions to be checked on site by contractor
3. Do not scale from this drawing
4. Unless otherwise indicated all dimensions are in millimetres

No.	Date	Auth	Dwn	Rev	REVISIONS
E	01/03/2013	PXD	ARR	-	ANNOTATION OMITTED
D	14/01/2013	ARR	PXD	A	AS NOTED
C	18/12/2012	ARR	PXD	B	AS NOTED~ALL 'PMP' NUMBERS REFER TO NEW ITEMS TO DRAWING & ALL BOLDED & ITALICIZED QUANTITIES INDICATE CHANGES TO QUANTITIES IN THIS REVISION
B	25/09/2012	ARR	PXD	A	AS NOTED
A	01/08/2012	ARR	PXD	-	CHANGE TO HATCHING PATTERN
-	01/05/2012	ARR	PXD	-	INITIAL ISSUE
H	28/03/2013	ARR	PXD		AS PER 13th MARCH 2013 SITE INSPECTION & AS DESCRIBED IN SITE INSPECTION NOTES
G	18/02/2013	ARR	PXD		AS PER SKELLINGTON WORKSHOP EMAIL 18th March 2013
F	15/02/2013	ARR	PXD		AS PER SKELLINGTON WORKSHOP NOTES (X.XX indicated new repair. COLOUR CODING AS PER SWL

Job WESTMINSTER HALL CONSERVATION PROJECT
Title NORTH WALL EXTERNAL ELEVATION
Proposed Repair Works

Job	PW.WH2	Status	C
No	2001	Rev	H
Scale (A1) 1:	50		

Last saved on 28/03/2013 filename:w:\jobs\pw.wh.2\sheets\2 general arrangement\2001g north wall external elevation.dwg by ARR