

Job	WESTMINSTER HALL CONSERVATION PROJECT	Status	C
Job No.	2003	Rev	K
State (A1) :	20		

Job pw.WH2	Status C
No 2003	Rev K
Scale (A1) 1:	20

Remove existing loose or disfiguring mortar and re-point as C42/506 using lime mortar to match approved sample as Z21.

Remove loose surface with a stiff/ soft bristle brush as C42/120. Brush back to sound surface and seek further instructions.

Clean stone surfaces using a single application of Arte Mundiit V, as C40/500-510. A secondary application of Laponite may be required and will be instructed by the Project Manager if necessary.

~~Cut out failing existing stone and replace with new stone indent.~~

Hatch not in use

~~Cut out decayed existing stone in its entirety and replace with new stone.~~

Cracks in existing stonework to be repaired as annotated.

Carefully remove glazing panel and set aside for reinstatement as L50/51.

1. Refer to carved stonework repair schedule for works to the frieze, label stops and heraldic beasts.
2. All glazing to be removed by glazing specialist and reinstated on completion of masonry cleaning and repairs.


Magnesian Limestone full stone replacement

Magnesian Limestone stone indent

Bath Stone full stone replacement
(N.B. stone indents to transoms)

Bath Stone indent

Plastic Repair

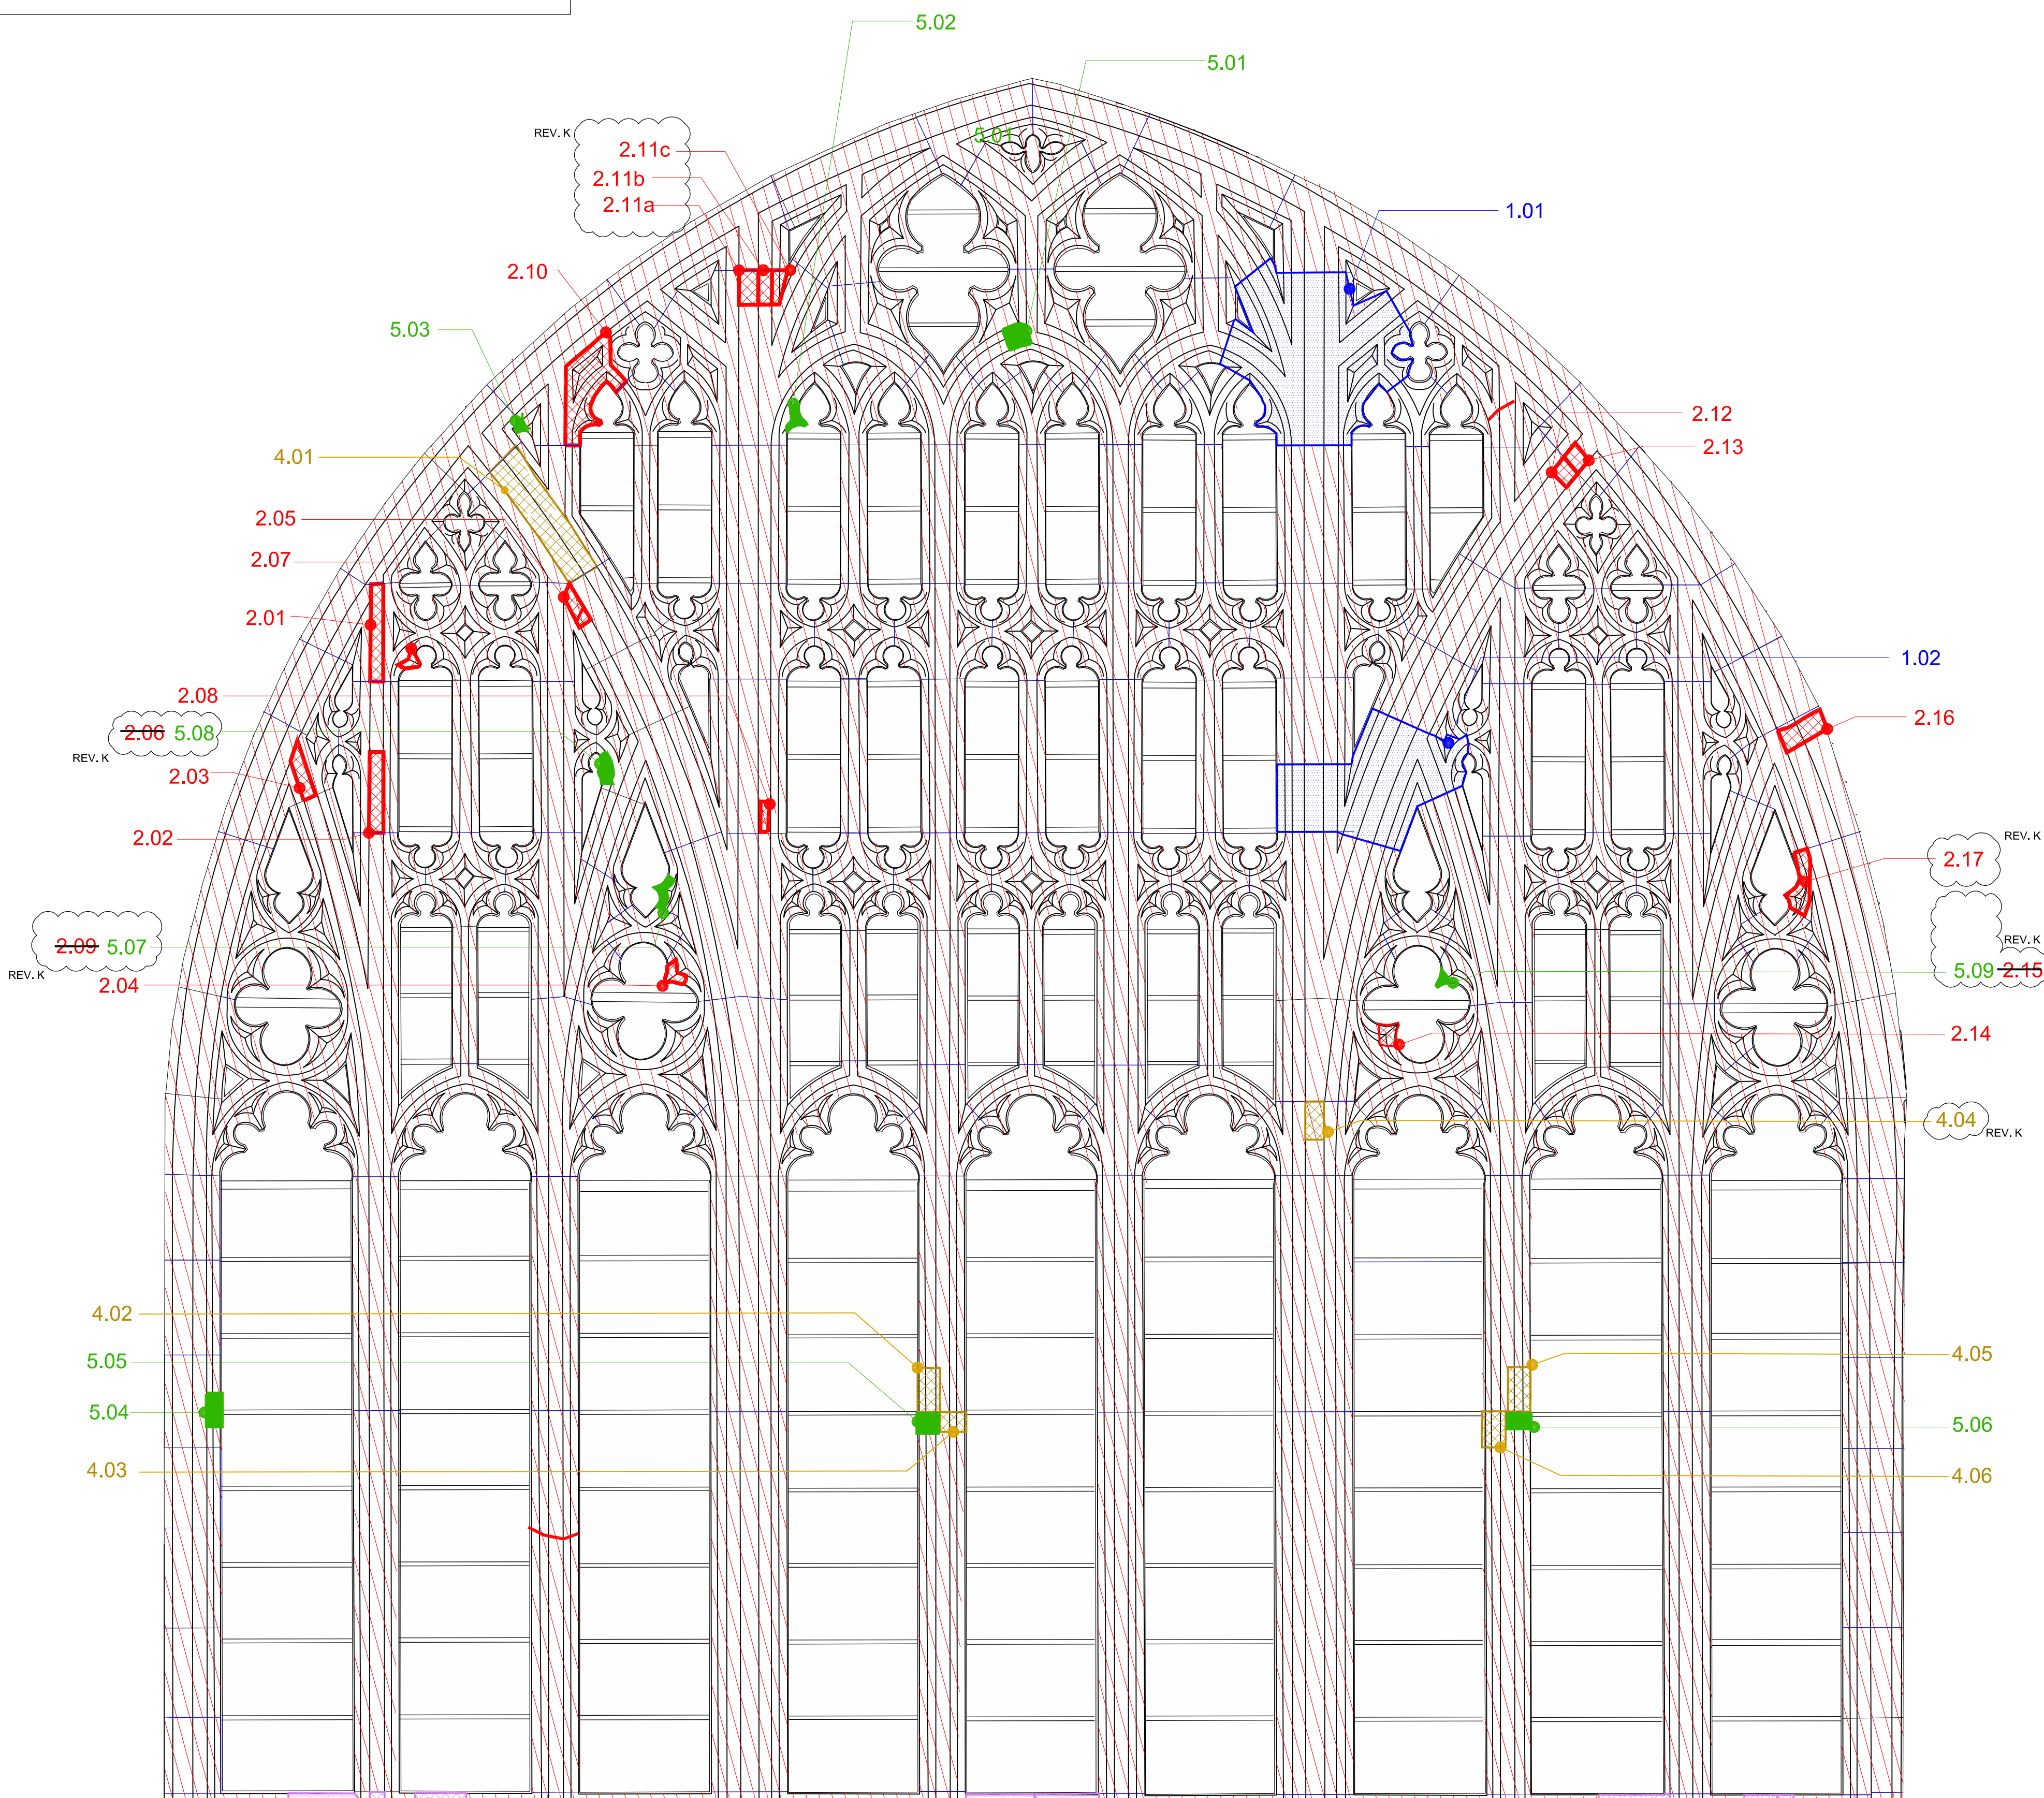

See DIA Drawing 2004 for Part 2 of the North Internal Tracery